

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL011035	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING _____	(X3) DATE SURVEY COMPLETED 08/11/2015
--	--	---	---

NAME OF PROVIDER OR SUPPLIER BROOKDALE ASHEVILLE WALDEN RIDGE	STREET ADDRESS, CITY, STATE, ZIP CODE 4 WALDEN RIDGE DRIVE ASHEVILLE, NC 28803
---	--

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
C 000	<p>Initial Comments</p> <p>Report of Biennial Construction Survey by Dennis Harrell and Greg Cares on 8-11-2015.</p> <p>Records indicate that this facility was first licensed or submitted for licensure on 7-30-1998, for the licensed capacity of 38 residents. Based on this information, the facility is required to meet the 1996 Rules for Homes for the Aged and Disabled - Minimum Standards and Regulations, applicable portions of the 2005 Rules for Adult Care Homes of Seven or More Beds, and the applicable portions of the 1996 North Carolina State Building Code, Volume I General Construction, Section 409.1, Group I - Unrestrained.</p>	C 000		
C 133	<p>Bathrooms-Hand Grips</p> <p>SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0305 PHYSICAL ENVIRONMENT (e) The requirements for bathrooms and toilet rooms are: (6) Hand grips shall be installed at all commodes, tubs and showers used by or accessible to residents;</p> <p>This Rule is not met as evidenced by: Based on observation, the hand grip provided at the toilet in the bathroom off room C7 was loosely mounted to the wall. Loose hand grips could cause a resident to fall.</p>	C 133		
C 166	<p>Housekeeping-Maintained Free of Hazards</p> <p>SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0306 HOUSEKEEPING AND FURNISHINGS</p>	C 166		

Division of Health Service Regulation
LABORATORY DIRECTOR'S OR PROVIDER/SUPPLIER REPRESENTATIVE'S SIGNATURE _____ TITLE _____ (X6) DATE _____

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL011035	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING _____	(X3) DATE SURVEY COMPLETED 08/11/2015
--	--	---	---

NAME OF PROVIDER OR SUPPLIER BROOKDALE ASHEVILLE WALDEN RIDGE	STREET ADDRESS, CITY, STATE, ZIP CODE 4 WALDEN RIDGE DRIVE ASHEVILLE, NC 28803
---	--

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
C 166	<p>Continued From page 1</p> <p>(a) Adult care homes shall: (5) be maintained in an uncluttered, clean and orderly manner, free of all obstructions and hazards; (e) This Rule shall apply to new and existing facilities.</p> <p>This Rule is not met as evidenced by:</p> <ol style="list-style-type: none"> Based on observation, the range in the kitchen was equipped with an integral shelf above the cooking surface. The placement of the range under the hood was such that the nozzles of the hood fire suppression system were pointed as much at the shelf as at the cooking surface. Consult with the range hood inspection company to verify that the direction of the fire suppression nozzles is appropriate to extinguish a fire on the range cooking surface. Based on observation, the floor coverings in several of the exit corridors were broken and presented a trip and fall hazard in at least 2 of the exit corridors. Findings include: <ol style="list-style-type: none"> The floor covering was broken and turned up on the edge, presenting a trip hazard in the exit corridor near room A3. The floor covering was broken and turned up on the edge, presenting a trip hazard in the exit corridor near room D3. Based on observation, the hose on the hair wash wand in the Beauty Salon was long enough to reach the sink basin and there was no vacuum breaker provided. Hoses on water fixtures that are long enough to reach the flood rim of the fixture present the possibility of siphoning contaminated water into the water system unless a vacuum breaker is installed. 	C 166		

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL011035	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING _____	(X3) DATE SURVEY COMPLETED 08/11/2015
--	--	---	---

NAME OF PROVIDER OR SUPPLIER BROOKDALE ASHEVILLE WALDEN RIDGE	STREET ADDRESS, CITY, STATE, ZIP CODE 4 WALDEN RIDGE DRIVE ASHEVILLE, NC 28803
---	--

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
C 189	Continued From page 2	C 189		
C 189	<p>Building Equipment Maintained Safe, Operating</p> <p>SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0311 OTHER REQUIREMENTS</p> <p>(a) The building and all fire safety, electrical, mechanical, and plumbing equipment in an adult care home shall be maintained in a safe and operating condition.</p> <p>(k) This Rule shall apply to new and existing facilities with the exception of Paragraph (e) which shall not apply to existing facilities.</p> <p>This Rule is not met as evidenced by:</p> <ol style="list-style-type: none"> 1. Based on observation, one of the cross-corridor doors near room D2 failed to close completely when activated by the fire alarm system. Cross-corridor doors that do not close completely present the possibility that a fire that begins in one space can quickly spread through the corridor to the remainder of the facility. 2. Based on observation, the exterior exit path at the exit near room B8 was obstructed with several chairs. Obstructed exit paths could delay or prevent an evacuation in an emergency. 3. Based on observation, some exit corridors were obstructed with stored items. Obstructed exit corridors could delay or prevent an evacuation in an emergency. Findings include: <ol style="list-style-type: none"> a. There were items stored in the exit corridor near room B8. b. There was a box springs and mattress stored in the exit corridor near room D3. 4. Based on observation, many corridor doors 	C 189		

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL011035	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING _____	(X3) DATE SURVEY COMPLETED 08/11/2015
--	--	---	---

NAME OF PROVIDER OR SUPPLIER BROOKDALE ASHEVILLE WALDEN RIDGE	STREET ADDRESS, CITY, STATE, ZIP CODE 4 WALDEN RIDGE DRIVE ASHEVILLE, NC 28803
---	--

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
C 189	<p>Continued From page 3</p> <p>are not closing completely or are not properly fitting the opening to resist the passage of fire and smoke. Corridor doors that do not close completely and latch present the possibility that a fire that begins in one space can quickly spread to the corridor and the remainder of the facility. Findings include;</p> <ol style="list-style-type: none"> a. The door to room C2 has sagged and will not close and latch. b. The door to the laundry near room A8 did not properly fit the opening at the top of the door. c. The door to room D1 did not properly fit the opening at the top of the door. d. The door to room D2 did not properly fit the opening at the top of the door. e. The door to room D5 did not properly fit the opening at the top of the door. f. The door to room D6 did not properly fit the opening at the top of the door. <p>5. Based on observation, the closer and latch had been removed from the ¾ fire rated door separating the kitchen from an exit access corridor. Fire rated doors that do not close and latch could render the exit corridor unusable in a fire.</p> <p>6. Based on observation, the ¾ fire rated door separating the kitchen from the serving kitchen, which is open to the dining room, could be obstructed from closing completely and latching by a slide bolt latch. Fire rated doors that do not close and latch could allow fire to spread quickly from the kitchen to the dining room and possibly to the corridor.</p> <p>7. Based on observation, the fire rated glass is missing from the ¾ fire rated door separating the kitchen from the pantry. Incomplete fire rated doors could allow a fire to spread quickly.</p>	C 189		

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL011035	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING _____	(X3) DATE SURVEY COMPLETED 08/11/2015
--	--	---	---

NAME OF PROVIDER OR SUPPLIER BROOKDALE ASHEVILLE WALDEN RIDGE	STREET ADDRESS, CITY, STATE, ZIP CODE 4 WALDEN RIDGE DRIVE ASHEVILLE, NC 28803
---	--

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
C 189	<p>Continued From page 4</p> <p>8. Based on observation, the facility failed to be maintained free of hazards because of exit signs not working. Exit signs that do not work could delay an evacuation in an emergency. Findings include: a. The required exit sign was not working in the exit corridor near room B8. b. The required exit sign was not working in the exit corridor near room C8.</p> <p>9. Based on observation the required one-hour fire rated walls and/or ceilings were compromised in several locations. Holes and penetrations that are not sealed with materials approved for use in one-hour fire rated construction and inoperable ceiling radiation dampers present the possibility that a fire that begins in one space can quickly spread to other areas of the facility. Findings include: a. The listed ceiling radiation damper in the HVAC duct penetration in the corridor near room C7 was tied open with wire. Dampers that are held open with means other than a manufacturer's approved fuse link will not close properly in the event of a fire. b. The attic access doors in the employee lounge and near the mechanical/sprinkler riser room were of one layer of gypsum board resting on wood casing. Attic access doors constructed this way cannot meet one-hour fire protection requirements. c. Hole at the sprinkler line in the ceiling of the sprinkler riser room. d. Holes in ceiling of maintenance room. e. Cover plates missing on wall electrical junction boxes in mechanical closet near room C8. f. Cover plate missing on receptacle outlet in Business office. g. Hole in ceiling of Business office.</p>	C 189		

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL011035	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING _____	(X3) DATE SURVEY COMPLETED 08/11/2015
--	--	---	---

NAME OF PROVIDER OR SUPPLIER BROOKDALE ASHEVILLE WALDEN RIDGE	STREET ADDRESS, CITY, STATE, ZIP CODE 4 WALDEN RIDGE DRIVE ASHEVILLE, NC 28803
---	--

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
C 189	Continued From page 5 h. The listed ceiling radiation dampers in the HVAC duct penetrations in the corridor near rooms B8 and C8 were very dirty. Dampers that are not periodically inspected and cleaned may not close properly in the event of a fire.	C 189		
C 199	Exhaust Ventilation SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0311 OTHER REQUIREMENTS (g) The spaces listed in this Paragraph shall be provided with exhaust ventilation at the rate of two cubic feet per minute per square foot. This requirement does not apply to facilities licensed before April 1, 1984, with natural ventilation in these specified spaces: (1) soiled linen storage; (2) soil utility room; (3) bathrooms and toilet rooms; (4) housekeeping closets; and (5) laundry area. (k) This Rule shall apply to new and existing facilities with the exception of Paragraph (e) which shall not apply to existing facilities. This Rule is not met as evidenced by: Based on observation the facility failed to maintain required exhaust in a working condition. Non-functioning exhaust could cause an unhealthy buildup of moisture and possibly bacteria. Findings include; a. The exhaust was not working in the bathroom off room B5. b. The exhaust was not working in the mop closet off the laundry. c. The exhaust was not working in the mop closet near the kitchen.	C 199		

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL011035	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING _____	(X3) DATE SURVEY COMPLETED 08/11/2015
--	--	---	---

NAME OF PROVIDER OR SUPPLIER BROOKDALE ASHEVILLE WALDEN RIDGE	STREET ADDRESS, CITY, STATE, ZIP CODE 4 WALDEN RIDGE DRIVE ASHEVILLE, NC 28803
---	--

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE