

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL012004	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING _____	(X3) DATE SURVEY COMPLETED R 04/12/2016
--	--	---	---

NAME OF PROVIDER OR SUPPLIER MCALPINE ADULT CARE	STREET ADDRESS, CITY, STATE, ZIP CODE 3806 KATHY ROAD MORGANTON, NC 28655
--	---

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
{C 000}	Initial Comments Report of Follow-up Survey by Dennis Harrell on 4-12-2016. Many deficiencies were not corrected. Further action is required.	{C 000}		
{C 111}	Must Have Current San. & Fire Safety Reports SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0302 DESIGN AND CONSTRUCTION f) The facility shall have current sanitation and fire and building safety inspection reports which shall be maintained in the home and available for review. This Rule is not met as evidenced by: Based on a review of documents, the most recent sanitation report for the building was dated 8-22-2014. Sanitation inspections are required at least annually.	{C 111}		
{C 164}	Housekeeping and Furnishings-Clean, Repaired SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0306 HOUSEKEEPING AND FURNISHINGS (a) Adult care homes shall: (1) have walls, ceilings, and floors or floor coverings kept clean and in good repair; (2) have no chronic unpleasant odors; (3) have furniture clean and in good repair; (e) This Rule shall apply to new and existing facilities. This Rule is not met as evidenced by: 2. Based on observation, the facility was not kept in good repair.	{C 164}		

Division of Health Service Regulation
LABORATORY DIRECTOR'S OR PROVIDER/SUPPLIER REPRESENTATIVE'S SIGNATURE _____ TITLE _____ (X6) DATE _____

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL012004	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING _____	(X3) DATE SURVEY COMPLETED R 04/12/2016
--	--	---	---

NAME OF PROVIDER OR SUPPLIER MCALPINE ADULT CARE	STREET ADDRESS, CITY, STATE, ZIP CODE 3806 KATHY ROAD MORGANTON, NC 28655
--	---

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
{C 164}	Continued From page 1 Findings include: a. A slat was broken out of the louvered closet door in bedroom 13, b. A slat was broken out of the louvered closet door in bedroom 14. 4. Based on observation, the HVAC return registers on the walls near the ceiling were very dirty.	{C 164}		
{C 166}	Housekeeping-Maintained Free of Hazards SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0306 HOUSEKEEPING AND FURNISHINGS (a) Adult care homes shall: (5) be maintained in an uncluttered, clean and orderly manner, free of all obstructions and hazards; (e) This Rule shall apply to new and existing facilities. This Rule is not met as evidenced by: 2. Based on observation, the hose on the hair wash wand in the Beauty Salon was long enough to reach the sink basin and there was no vacuum breaker provided. Hoses on water fixtures that are long enough to reach the flood rim of the fixture present the possibility of siphoning contaminated water into the water system unless a vacuum breaker is installed. 4. Based on observation, a knockout was missing in a 4 inch electrical junction box in the dining room. Unsealed openings in junction boxes expose residents to energized wires.	{C 166}		
{C 189}	Building Equipment Maintained Safe, Operating	{C 189}		

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL012004	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING _____	(X3) DATE SURVEY COMPLETED R 04/12/2016
--	--	---	---

NAME OF PROVIDER OR SUPPLIER MCALPINE ADULT CARE	STREET ADDRESS, CITY, STATE, ZIP CODE 3806 KATHY ROAD MORGANTON, NC 28655
--	---

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
{C 189}	<p>Continued From page 2</p> <p>SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0311 OTHER REQUIREMENTS</p> <p>(a) The building and all fire safety, electrical, mechanical, and plumbing equipment in an adult care home shall be maintained in a safe and operating condition.</p> <p>(k) This Rule shall apply to new and existing facilities with the exception of Paragraph (e) which shall not apply to existing facilities.</p> <p>This Rule is not met as evidenced by:</p> <p>1. Based on observation the required one-hour fire rated walls and/or ceilings were compromised in several locations. Holes and penetrations that are not sealed with materials approved for use in one-hour fire rated construction present the possibility that a fire that begins in one space can quickly spread to other areas of the facility. Findings include:</p> <ul style="list-style-type: none"> a. Holes through the 2 hour fire wall, b. Holes in the ceiling tiles in the Medication Department, c. Holes in the ceiling tiles in the kitchen, d. Holes in the ceiling tiles in the pantry, e. Holes in the ceiling tiles in bedroom 9, f. Holes in the ceiling tiles in bedroom 10, g. Broken ceiling tiles in bedroom 13, h. Holes in the wall in the janitor closet, i. Small ceiling above the water fountain near bedroom 13 is only one layer of ½ inch gypsum wall board, j. Hole in ceiling of outside housekeeping room, k. Portion of ceiling missing in weight room, l. This facility is equipped with a one hour fire rated suspended ceiling system. Tiles have been replaced in areas throughout the facility. Please provide verification that the replaced ceiling tiles are fire rated tiles. 	{C 189}		

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL012004	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING _____	(X3) DATE SURVEY COMPLETED R 04/12/2016
--	--	---	---

NAME OF PROVIDER OR SUPPLIER MCALPINE ADULT CARE	STREET ADDRESS, CITY, STATE, ZIP CODE 3806 KATHY ROAD MORGANTON, NC 28655
--	---

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
{C 189}	<p>Continued From page 3</p> <p>3. Based on interview with the maintenance staff and an owner, work has recently been done above the suspended ceilings on the fire alarm system. The work included installing or moving duct mounted smoke detectors. The maintenance person onsite was not sure of the locations of the duct mounted smoke detectors. Without knowing the locations of the detectors, they could not be inspected. Sampling tubes that are not periodically inspected and cleaned may cause the duct detector to not work properly in the event of a fire.</p> <p>4. Based on observation, the battery powered emergency lights in the weight room and the beauty salon would not work when tested. Battery powered emergency lights that will not work properly for at least 90 minutes could endanger the residents and staff.</p> <p>5. Based on observation, the double dining room doors are not equipped with the proper hardware to allow them to latch closed to resist the passage of fire and smoke. Corridor doors that do not close completely and latch present the possibility that a fire that begins in one space can quickly spread to the corridor and the remainder of the facility.</p> <p>6 Based on observation, the exterior light at the exit near bedroom 17 would not work. Unilluminated exit paths could delay an evacuation in an emergency.</p> <p>7. Based on observation, the 3/4 inch pressure relief valve on the water heater in the outside housekeeping room was piped with 1/2 inch pipe. Pressure relief valves must be connected with pipe at least as large as the valve.</p>	{C 189}		

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL012004	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING _____	(X3) DATE SURVEY COMPLETED R 04/12/2016
--	--	---	---

NAME OF PROVIDER OR SUPPLIER MCALPINE ADULT CARE	STREET ADDRESS, CITY, STATE, ZIP CODE 3806 KATHY ROAD MORGANTON, NC 28655
--	---

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
{C 189}	Continued From page 4	{C 189}		
{C 199}	<p>8. Based on observation, a roof gutter was severely deteriorated outside the exit near the weight room.</p> <p>Exhaust Ventilation</p> <p>SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0311 OTHER REQUIREMENTS</p> <p>(g) The spaces listed in this Paragraph shall be provided with exhaust ventilation at the rate of two cubic feet per minute per square foot. This requirement does not apply to facilities licensed before April 1, 1984, with natural ventilation in these specified spaces:</p> <ol style="list-style-type: none"> (1) soiled linen storage; (2) soil utility room; (3) bathrooms and toilet rooms; (4) housekeeping closets; and (5) laundry area. <p>(k) This Rule shall apply to new and existing facilities with the exception of Paragraph (e) which shall not apply to existing facilities.</p> <p>This Rule is not met as evidenced by: Based on observation the facility failed to maintain required exhaust in a working condition. Non-functioning exhaust could cause an unhealthy buildup of moisture and possibly bacteria.</p> <p>Findings include;</p> <ol style="list-style-type: none"> a. The exhaust fan was removed from the housing in the bathroom off the kitchen. b. The exhaust system provided was not working in the janitor closet. c. The exhaust system provided was not working in the small men's bath. 	{C 199}		